



COMMONWEALTH of VIRGINIA

Department of Health
DIVISION OF SHELLFISH SANITATION
109 Governor Street, Room 614-B
Richmond, VA 23219

Ph: 804-864-7487
Fax: 804-864-7481

Chincoteague Bay
Growing Area # 100
Accomack County
Shoreline Sanitary Survey

Date: 5 July 2013

Survey Period: October 21, 2011 – May 13, 2013

Total Number of Properties Surveyed: 3345

Surveyed By: D.P. Miller and S.E. Price

SECTION A: GENERAL

This survey area extends from Reference Point 99A at the northwest end of the Black Narrows Bridge to Reference Point 100 at the Virginia-Maryland state line where it intersects the western Chincoteague Bay shoreline, including Chincoteague Bay shoreline between these two points, Middle Mouth, Wire Narrows, Far Mouth, New Virginia Cove, Queen Sound Channel, Cockle Creek, Mosquito Creek, Little Mosquito Creek (Wattsville Branch, Wallops Pond, Snead Branch), Horntown Bay, Coldkall Creek, Swans Gut Creek, (Selby Branch, Sand Branch), Powell Creek, Guys Point Gut, and all of their tributaries.

The topography of the area varies from low and marshy along bays and creeks, to patches of elevated ground reaching 30 feet above sea level. Some residential areas experience frequent ponding of rainwater and occasional marine flooding.

The population is generally sparse, with notable concentrations at Trail's End Campground (~2500 properties bordering Mosquito Creek) and Captain's Cove (~300 properties between Swans Gut Creek and Powell Creek). A third development, Old Mill Pointe (~100 lots bordering Wattsville Branch) is still in the early stages of development. In addition, small rural communities exist at Greenbackville, Wattsville, and Horntown. The economy in this area is based largely upon seafood, agriculture and the NASA Wallops Flight Facility.

The dwellings and businesses throughout the watershed are served primarily by private septic systems. Development is moderate, with 84 land-disturb permits issued during the survey period listing as follows: Captain's Cove, 51 permits; Trails End Campground, 24; Corbin Hall, 3; Franklin City, 1; and Olde Mill Pointe, 5. Animal activity is primarily from wildlife with significant populations of waterfowl, deer, and small game visible during the survey period. Small livestock farms are also present in low numbers.

Meteorological data indicated that a total of 66.08" of rain fell during the survey period. A monthly breakdown of rainfall (inches) is as follows:

| | | | | | |
|---------------------|-------|-----------|-------|--------------|-------|
| October 21-31, 2011 | 1.22" | May | 3.36" | December | 4.02" |
| November | 2.81" | June | 3.00" | January 2013 | 3.28" |
| December | 1.32" | July | 3.44" | February | 7.23" |
| January 2012 | 2.59" | August | 4.95" | March | 4.01" |
| February | 2.67" | September | 4.09" | April | 2.98" |
| March | 2.51" | October | 7.52" | May 1-13 | 0.82" |
| April | 3.59" | November | 0.67" | | |

† Data obtained from NOAA rainfall database station 100-8V.

Notable changes since the previous survey were:

- The survey area, while continuing to cover the same watersheds, has been significantly reduced in land mass in order to increase the focus on those areas of shoreline whose activities will most likely impact the watershed. Excluded were portions of the communities of Horntown, Wattsville, and Sign Post, as well as an area consisting primarily of crop fields and woods west of Fleming Road.
- The number of properties surveyed increased from 2701 in 2003, to 3345 in 2013.
- Animal Pollution contributors dropped from 14 to 6. The number of commercial poultry farms in the survey dropped to zero as a result of operations closing down (2) and due to being far enough away from the watershed to be outside of the new survey boundary (7).
- During 2010, the Captain's Cove sewage treatment facility experienced a sewage failure (Consent Order is attached). The Captain's Cove Utility Company is now under new management. The pump station along Swan's Gut has also been reinforced, with tentative plans to relocate this pump station in the future.

Copies of bacteriological, hydrographical, and shellfish closure data are available at the area Field office for review. Copies of the current condemnation notices and maps are available via the internet at www.vdh.virginia.gov/shellfish/.

Information in this report is gathered, and is primarily for use by the Virginia Department of Health, Division of Shellfish Sanitation in order to fulfill its responsibilities of shellfish growing area supervision and classification. However, the data are made available to various agencies participating in shellfish program coordinated activities, as well as other interested parties.

Report copies are provided to the local health department for corrective action of deficiencies listed on the summary page in Sections B.2. and B.3., and to the Department of Environmental Quality for possible action at properties listed on the summary page in Sections B.1., C.1. and C.2. The Division of Soil & Water Conservation is provided information on the possible sources of animal pollution found in Section E.

This report lists only those properties that have a sanitary deficiency or other environmental significance. "**DIRECT**" indicates that the significant activity or deficiency has a direct impact on shellfish waters. Individual Field forms with full information on properties listed in this report are on file in the Richmond Office of the Division of Shellfish Sanitation and are available for reference until superseded by a subsequent resurvey of the area.

SECTION B: SEWAGE POLLUTION SOURCES

SEWAGE TREATMENT FACILITIES

1. National Aeronautics and Space Administration (NASA), Wallops Station 23337, Field # S1. Sewage treatment plant receiving sewage from NASA station, Marine Science Consortium, and Wallops Island (area 99). 900 persons. Design capacity is 800,000 gpd. Components are dual comminutors, primary settling tank, dosing tank, trickling

filters, secondary clarifier, sludge digester, sludge drying beds, and chlorine contact tank. The chlorinated effluent discharges into a ditch that drains into Mosquito and Cat Creeks. Field # S1.

152. Location: 2512 Captain's Corridor, Greenbackville. Facility serves over 200 residences in the sewered section of Captain's Cove. Two lagoons onsite treat effluent. Thomas Harmon, Captain's Cove Utility Company Operator was the person of contact. Field # D460.
- 153 Location: 2518 Captain's Corridor, Greenbackville. Separate building onsite serves as the maintenance building for the utility company. Thomas Harmon, Captain's Cove Utility Company Operator was the person of contact. Field # D461.

ONSITE SEWAGE DEFICIENCIES

3. CONTRIBUTES POLLUTION – Location: 33074 Davis Court, Wattsville. Dwelling – white and green mobile home. No contact. Septic pipe between home and septic tank is ruptured with a 6” hole discharging raw sewage on the ground. Active discharge at inspection. Sanitary Notice issued 2 March 2012 to Field # S8.
4. CONTRIBUTES POLLUTION – Location: 7141 Juniper Lane, New Church. Dwelling – RV in back yard of 1 story white vinyl home. RV is occupied by a family of 4 who are using home as a temporary dwelling. Flexible sewage hose from RV is discharging raw sewage to the ground surface. Sewage odor evident, waste material visible. Sanitary Notice issued 23 March 2012 to Field # S67.
5. CONTRIBUTES POLLUTION - Location: Lot 64 Cedar Drive, Horntown. Dwelling- “Wildwood” RV. No contact. RV’s sewage pipe is uncapped and open to the environment. Sanitary Notice issued 6 April 2012 to Field # S125. *Corrected prior to survey completion/publication.*
6. CONTRIBUTES POLLUTION – Location: Lot 63 Cedar Drive, Horntown. Dwelling – “Kropf” RV. No contact. RV’s sewage pipe is uncapped and open to the environment. Sanitary Notice issued 6 April 2012 to Field # S126. *Corrected prior to survey completion/publication.*
7. CONTRIBUTES POLLUTION – Location: Lot 59, Pine Drive, Horntown. No contact. Dwelling – “Nomad” RV. RV’s sewage pipe is uncapped and open to the environment. Sanitary Notice issued 6 April 2012 to Field # S130. *Corrected prior to survey completion/publication.*
8. CONTRIBUTES POLLUTION – Location: Lot 34, 4-1 Cedar Court, Horntown. No contact. Dwelling – “Prowler” RV. Flexible sewage hose is cracked and open to the environment. Sanitary Notice issued 6 April 2012 to Field # S145.
9. CONTRIBUTES POLLUTION – Location: Lot 33, 4-1 Cedar Court, Horntown. No contact. Dwelling – “Citation” RV. RV’s sewage pipe is uncapped and open to the environment. Sanitary Notice issued 6 April 2012 to Field # S146. *Corrected prior to survey completion/publication.*
10. CONTRIBUTES POLLUTION – Location: Lot 17, 4-1 Pecan Court, Horntown. No contact. Lot with boardwalk and outbuildings. Sewage pipe to septic tank is uncapped and open to the environment. Sanitary Notice issued 6 April 2012 to Field # S158.

11. CONTRIBUTES POLLUTION – Location: Lots 1 & 2, 4-1 Cedar Drive, Horntown. Vacant lots with sewage connections (rental lots). Sewage pipe connected to septic tank has a makeshift cap (drink cup) that does not seal system from the environment. Sanitary Notice issued 6 April 2012 to Field # S167.
12. CONTRIBUTES POLLUTION – Location: Lot 85, 4-1 Holly Drive, Horntown. No contact. Dwelling – RV in poor condition in use as residence and cat sanctuary. RV's sewage pipe is uncapped and open to the environment. Sanitary Notice issued 20 April 2012 to Field # S169. *Corrected prior to survey completion/publication.*
13. CONTRIBUTES POLLUTION – Location: Lot 102, 4-1 Cedar Drive, Horntown. No contact. RV lot with outbuilding and septic system. Sewage pipe to septic tank is uncapped and open to the environment. Sanitary Notice issued 20 April 2012 to Field # S183.
14. CONTRIBUTES POLLUTION – Location: Lot 108, 4-1 Cedar Drive, Horntown. Dwelling – “Regal” RV. Flexible sewage hose is damaged, exposing sewage system to the environment. Sanitary Notice issued 20 April 2012 to Field # S188.
15. CONTRIBUTES POLLUTION – Location: Lot 114, 4-1 Cedar Drive, Horntown. Dwelling – “Style Line” RV. RV's sewage pipe is uncapped and disconnected from a portable sewage tank which is also uncapped, exposing sewage system to the environment. Sanitary Notice issued 20 April 2012 to Field # S194.
16. CONTRIBUTES POLLUTION – Location: Lot 2, 3-7 Wallops Mill Drive, Horntown. No contact. Dwelling – “Citation” RV. Sewage pipe to RV is uncapped and open to the environment. Sanitary Notice issued 20 April 2012 to Field # S200. *Corrected prior to survey completion/publication.*
17. CONTRIBUTES POLLUTION – Location: Lot 4, 3-7 Wallops Mill Drive, Horntown. No contact. Dwelling – “Wildwood” RV. Sewage pipe to RV is uncapped and open to the environment. Sanitary Notice issued 12 April 2012 to Field # S202. *Corrected prior to survey completion/publication.*
18. CONTRIBUTES POLLUTION – Location: Lot 12, 3-7 Warbler Court, Horntown. No contact. Dwelling – “Prowler” RV. RV's sewage pipe is uncapped and open to the environment. Sanitary Notice issued 20 April 2012 to Field # S209. *Corrected prior to survey completion/publication.*
19. CONTRIBUTES POLLUTION – Location: Lot 14, 3-7 Warbler Court, Horntown. No contact. Dwelling – “Callista” RV. RV's sewage pipe is uncapped and open to the environment. Sanitary Notice issued 20 April 2012 to Field # S212. *Corrected prior to survey completion/publication.*
20. CONTRIBUTES POLLUTION – Location: Lot 20, 3-7 Wallops Mill Drive, Horntown. No contact. Dwelling – RV with addition. One portion of the RV's sewage pipe is uncapped and open to the environment. Sanitary Notice issued 20 April 2012 to Field # S217. *Corrected prior to survey completion/publication.*
21. CONTRIBUTES POLLUTION – Location: Lot 29, 3-7 Wallops Mill Drive, Horntown. No contact. Dwelling – “Phoenix Shasta” RV. RV's sewage pipe is uncapped and open to the environment. Sanitary Notice issued 20 April 2012 to Field # S227. *Corrected prior to survey completion/publication.*

22. CONTRIBUTES POLLUTION – Location: Lot 42, 3-7 Woodthrush Court, Horntown. No contact. Dwelling – “Coachmen” RV. RV’s sewage pipe is uncapped and open to the environment. Sanitary Notice issued 20 April 2012 to Field # S236. *Corrected prior to survey completion/publication.*
23. CONTRIBUTES POLLUTION – Location: Lot 50, 3-7 Robin Lane, Horntown. No contact. Dwelling – “Terry” RV. RV’s sewage pipe is uncapped and open to the environment. Sanitary Notice issued 20 April 2012 to Field # S243. *Corrected prior to survey completion/publication.*
24. CONTRIBUTES POLLUTION – Location: Lot 51, 3-7 Robin Lane, Horntown. No contact. Dwelling – “Royal Coachmen” RV with addition. RV’s sewage pipe is uncapped and open to the environment. Sanitary Notice issued 20 April 2012 to Field # S245. *Corrected prior to survey completion/publication.*
25. CONTRIBUTES POLLUTION – Location: Lot 52, 3-7 Robin Lane, Horntown. No contact. Dwelling – RV. RV’s sewage pipe is uncapped and open to the environment. Sanitary Notice issued 20 April 2012 to Field # S246. *Corrected prior to survey completion/publication.*
26. CONTRIBUTES POLLUTION – Location: Lot 62, 3-7 Robin Lane, Horntown. No contact. Dwelling – “Columbia” RV. RV’s sewage pipe is uncapped and disconnected from portable tank. Flex-hose connected to portable sewage tank is also uncapped, exposing sewage system to the environment. Sanitary Notice issued 20 April 2012 to Field # S252.
27. CONTRIBUTES POLLUTION – Location: Lot 69, 3-7 Robin Lane, Horntown. No contact. Dwelling – “Avion” RV. RV’s sewage pipe is uncapped and open to the environment. Sanitary Notice issued 11 May 2012 to Field # S256. *Corrected prior to survey completion/publication.*
28. CONTRIBUTES POLLUTION – Location: Lot 71, 3-7 Robin Lane, Horntown. No contact. Dwelling – “Palm Air” RV. RV’s sewage pipe is uncapped and open to the environment. Sanitary Notice issued 11 May 2012 to Field # S258. *Corrected prior to survey completion/publication.*
29. CONTRIBUTES POLLUTION – Location: Lot 72, 3-7 Robin Lane, Horntown. No contact. Dwelling – “Coachmen” RV. Flexible sewage hose is dry rotted, with cracks and holes that expose sewage system to the environment. Sanitary Notice issued 11 May 2012 to Field # S259.
30. CONTRIBUTES POLLUTION – Location: Lot 93, 3-7 Blue Jay Court, Horntown. No contact. Dwelling – “Spartan” RV. Flexible sewage hose is disintegrated and separated into pieces, exposing sewage system to the environment. Sanitary Notice issued 11 May 2012 to Field # S279.
31. CONTRIBUTES POLLUTION – Location: Lot 96, 3-7 Blue Jay Court, Horntown. No contact. Dwelling – “Foxfire” RV. RV’s sewage pipe is uncapped. Flex-hose connected to the portable sewage tank is uncapped with the end on the ground, exposing sewage system contents to the environment. Sanitary Notice issued 11 May 2012 to Field # S282.

32. CONTRIBUTES POLLUTION – Location: Lot 257, 3-7 Dogwood Court, Horntown. No contact. Dwelling – RV, white with wood-grain stripe. Raw sewage actively discharging to the ground surface. Urine odor evident. Sanitary Notice issued 11 May 2012 to Field # S309.
33. CONTRIBUTES POLLUTION – Location: Lot 135, 3-7 Sycamore Court, Horntown. No contact. Dwelling – “Argosy” RV with roof and grey vinyl addition. RV’s flexible sewage hose is dry-rotted and coming apart, exposing sewage system to the environment. Sanitary Notice issued 18 May 2012 to Field # S325.
34. CONTRIBUTES POLLUTION – Location: Lot 153, 3-7 Wallops Mill Road, Horntown. No contact. Dwelling – “Coachmen” RV. Flexible sewage hose has dry-rotted and is coming apart, exposing sewage system to the environment. Sanitary Notice issued 18 May 2012 to Field # S343.
35. CONTRIBUTES POLLUTION – Location: Lot 162, 3-7 Wallops Mill Road, Horntown. No contact. Dwelling – “Prowler” RV. RV’s sewage pipe is uncapped and open to the environment. Sanitary Notice issued 18 May 2012 to Field # S351. *Corrected prior to survey completion/publication.*
36. CONTRIBUTES POLLUTION – Location: Lot 191, 3-7 Wallops Mill Road, Horntown. No contact. Dwelling – “Nomad” RV. RV’s sewage pipe is uncapped and open to the environment. Sanitary Notice issued 8 June 2012 to Field # S376. *Corrected prior to survey completion/publication.*
37. CONTRIBUTES POLLUTION – Location: Lot 226, 3-7 Willow Drive, Horntown. No contact. Dwelling – “Park Royale” RV. RV’s sewage pipe is open to the environment. Sanitary Notice issued 15 June 2012 to Field # S413. *Corrected prior to survey completion/publication.*
38. CONTRIBUTES POLLUTION – Location: Lot 259, 3-7 Dogwood Court, Horntown. No contact. Dwelling – “Mountain Aire” RV. Flexible sewage hose is disintegrating, with open coils leaving sewage system exposed to the environment. Sanitary Notice issued 15 June 2012 to Field # S439.
39. CONTRIBUTES POLLUTION (kitchen or laundry waste) – Location: Lot 265, 3-7 Dogwood Court, Horntown. No contact. Dwelling – RV under steel building. Laundry is set up in outbuilding (red shed) with waste pipe set up to discharge to ground surface. Sanitary Notice issued 15 June 2012 to Field # S444.
40. CONTRIBUTES POLLUTION – Location: Lot 276, 3-7 Bayberry Court, Horntown. No contact. Dwelling – “Chateau” RV. RV’s flexible sewage hose is disintegrating and has separated into an open coil, exposing sewage system to the environment. Home recently occupied. Sanitary Notice issued 15 June 2012 to Field # S456.
41. CONTRIBUTES POLLUTION – Location: Lot 294, 3-7 Willow Drive, Horntown. No contact. Dwelling – “Wildwood” RV. RV’s flexible sewage hose is dry-rotted and beginning to disintegrate, and is also unsealed at the connection, exposing sewage system to the environment. Sanitary Notice issued 29 June 2012 to Field # S474.
42. CONTRIBUTES POLLUTION – Location: Lot 309, 3-7 Poplar Court, Horntown. No contact. Dwelling – RV with beige T1-11 addition. RV’s flexible sewage hose is disintegrating. Portable sewage tank is uncapped and open to the environment. Sanitary Notice issued 29 June 2012 to Field # S486.

43. CONTRIBUTES POLLUTION - Location: Lot 314, 3-7 Wallops Mill Drive, Horntown. No contact. Dwelling – “Terry Resort” RV. Holes are present in the RV’s flexible sewage hose. Sanitary Notice issued 29 June 2012 to Field # S492.
44. CONTRIBUTES POLLUTION – Location: Lot 321, 3-7 Wallops Mill Drive, Horntown. No contact. Dwelling – “Salem” RV. RV’s sewage pipe has been dismantled and is open to the environment. Sanitary Notice issued 29 June 2012 to Field # S498.
45. CONTRIBUTES POLLUTION – Location: Lot 324, 3-7 Wallops Mill Drive, Horntown. No contact. Dwelling – “Prowler” RV. RV’s sewage pipe is uncapped and open to the environment. Sanitary Notice issued 29 June 2012 to Field # S501. *Corrected prior to survey completion/publication.*
46. CONTRIBUTES POLLUTION – Location: Lot 111, 3-6 Wallops Mill Drive, Horntown. No contact. Dwelling – 1 story wood frame. Sewage pipe for lot is open to the environment. Sanitary Notice issued 29 June 2012 to Field # S518.
47. CONTRIBUTES POLLUTION – Location: Lot 108, 3-6 Wallops Mill Drive, Horntown. No contact. Dwelling – “Layton” RV. RV’s sewage pipe is uncapped and open to the environment. Sanitary Notice issued 29 June 2012 to Field # S522. *Corrected prior to survey completion/publication.*
48. CONTRIBUTES POLLUTION – Location: Lot 80, 3-6 Pin Oak Court, Horntown. No contact. Dwelling – “Prowler” RV. RV’s sewage pipe is uncapped and open to the environment. Sanitary Notice issued 6-Jul 2012 to Field # S549. *Corrected prior to survey completion/publication.*
49. CONTRIBUTES POLLUTION – Location: Lot 49, 3-6 Wallops Mill Drive, Horntown. No contact. Dwelling – “Challenger” RV. RV’s sewage cap is adapted to feed liquid waste into a connected garden hose that drains to the ground surface. Lint at outfall of garden hose is evidence of recent discharge. Sanitary Notice issued 13 July 2012 to Field # S612.
50. CONTRIBUTES POLLUTION – Location: Lot 21, 3-6 Wallops Mill Drive, Horntown. No contact. Dwelling – “Terry” RV. RV’s flexible sewage hose is dry-rotted and has separated. Sanitary Notice issued 13 July 2012 to Field # S618.
51. CONTRIBUTES POLLUTION (kitchen or laundry waste) – Location: Lot 9, 3-6 Wallops Mill Drive, Horntown. No contact. “Mallard” RV. Washer and dryer are set up outdoors behind RV. Washer has effluent hose set up to discharge to ground surface. Sanitary Notice issued 13 July 2012 to Field # S629.
52. CONTRIBUTES POLLUTION – Location: Lot 173, 3-6 Bay Breeze Drive, Horntown. Dwelling – “Mallard” RV. RV’s flexible sewage hose is dry-rotted with cracks and holes. Sanitary Notice issued 20 July 2012 to Field # S637.
53. CONTRIBUTES POLLUTION – Location: Lot 169, 3-6 Wallops Mill Drive, Horntown. No contact. Dwelling – “Holiday Rambler” RV. RV’s sewage pipe is uncapped and open to the environment. Sanitary Notice issued 20 July 2012 to Field # S651. *Corrected prior to survey completion/publication.*

54. CONTRIBUTES POLLUTION – Location: Lot 151, 3-6 Wallops Mill Drive, Horntown. No contact. Dwelling – “Wilderness” RV. RV’s sewage pipe is open and actively dripping to the ground surface. Portable sewage tank is nearby but not connected. Sanitary Notice issued 20 July 2012 to Field # S659.
56. CONTRIBUTES POLLUTION – Location: Lot 216, 3-6 Hemlock Drive, Horntown. No contact. Dwelling – “Cougar” RV. RV’s sewage hose is on the ground and open to the environment. Portable tank nearby is capped. Sanitary Notice issued 3 August 2012 to Field # S686.
57. CONTRIBUTES POLLUTION – Location: Lot 217, 3-6 Hemlock Lane, Horntown. Dwelling – “Nomad” RV. RV’s sewage pipe is disconnected from portable sewage tank, with open end on the ground surface. Sanitary Notice issued 3 August 2012 to Field # S687.
58. CONTRIBUTES POLLUTION – Location: Lot 218, 3-6 Hemlock Lane, Horntown. No contact. Dwelling – “Alumascape” RV. RV’s sewage hose is dry-rotted and cracked, exposing system to the environment. Sanitary Notice issued 3 August 2012 to Field # S688.
59. CONTRIBUTES POLLUTION – Location: Lot 210, 3-6 Bluebill Drive, Horntown. No contact. Dwelling – “Salem” RV. RV’s flexible sewage hose is dry-rotted, with cracks exposing the system to the environment. Sanitary Notice issued 3 August 2012 to Field # S693.
60. CONTRIBUTES POLLUTION – Location: Lot 306, 3-6 Bluebill Drive, Horntown. No contact. Dwelling – “Wilderness” RV. RV’s flexible sewage hose is dry-rotted, with cracks that expose system contents to the environment. Sanitary Notice issued 3 August 2012 to Field # S726.
62. CONTRIBUTES POLLUTION – Location: Lot 277, 3-6 Willow Drive, Horntown. No contact. Dwelling – small camper. Apparent grey water (kitchen sink?) effluent piped to ground surface. Sanitary Notice issued 14 September 2012 to Field # S765.
63. CONTRIBUTES POLLUTION – Location: Lot 260, 3-6 Hickory Court, Horntown. No contact. Dwelling – “Elite” RV. Washing machine is set up on porch with effluent to discharge over porch rail to ground surface. Sanitary Notice issued 14 September 2012 to Field # S782.
64. CONTRIBUTES POLLUTION – Location: Lot 259, 3-6 Hickory Court, Horntown. No contact. Dwelling – “Blazon” RV. RV’s flexible sewage hose is completely disintegrated, leaving system open to the environment. Sanitary Notice issued 14 September 2012 to Field # S783.
65. CONTRIBUTES POLLUTION – Location: Lot 259, 3-6 Hickory Court, Horntown. No contact. Dwelling – “Cavalier” RV. RV’s flexible sewage hose is dry-rotted, with holes that expose system to the environment. Sanitary Notice issued 14 September 2012 to Field # S784.
66. CONTRIBUTES POLLUTION – Location: Lot 78, 3-5 Dove Shell Court, Horntown. No contact. Dwelling – “Resort” RV. RV’s flexible sewage hose is dry-rotted, with cracks that expose system to the environment. Sanitary Notice issued 12 October 2012 to Field # S894.

67. CONTRIBUTES POLLUTION – Location: Lot 80, 3-5 Dove Shell Court, Horntown. Facility comfort station #14 (restroom/shower complex). Exterior of septic tank has a leak around the seal, with hairline cracks in the concrete. Sanitary Notice issued 12 October 2012 to Field # S897.
68. CONTRIBUTES POLLUTION – Location: Lot 98, 3-5 Bay Breeze Drive, Horntown. No contact. Dwelling – RV. RV’s septic system has been disconnected. Septic tank has a recently-installed sewage pipe connected to it, and pipe is open to the environment. Sanitary Notice issued 12 October 2012 to Field # S914.
69. CONTRIBUTES POLLUTION – Location: Lot 110, 3-5 Coral Court, Horntown. No contact. Dwelling – RV with 1-story tan vinyl addition. Raw sewage actively discharging to ground surface through flexible sewage hose. Neighbors complain of long-standing, repeated problem. Shingles stacked along ground surface as make-shift tile drain to shed raw sewage away from home. Sanitary Notice issued 12 October 2012 to Field # S926.
70. CONTRIBUTES POLLUTION – Location: Lot 120, 3-5 Periwinkle Drive, Horntown. No contact. Dwelling – “Layton” RV. RV’s sewage pipe drains to a garden hose, with outfall underground in a hole behind RV. There is no record of a septic system for this lot. Sanitary Notice issued 12 October 2012 to Field # S936.
71. CONTRIBUTES POLLUTION – Location: Lot 178, 3-5 Bay Breeze Drive, Horntown. No contact. Dwelling – “Sierra” RV. Flexible sewage hose is dry-rotted with cracks and holes that expose system to the environment. Sanitary Notice issued 26 October 2012 to Field # S992.
72. CONTRIBUTES POLLUTION – Location: Lot 199, 3-5 Nautilus Drive, Horntown. No contact. Dwelling – “Holiday Rambler” RV. RV’s sewage pipe is uncapped and open to the environment. Sanitary Notice issued 26 October 2012 to Field # S1015. *Corrected prior to survey completion/publication.*
73. CONTRIBUTES POLLUTION – Location: Lot 270, 3-5 Dove Shell Court, Horntown. No contact. Dwelling – “Monterey” RV on the waterfront. RV’s sewage pipe is uncapped, and the pipe to the septic tank is uncapped, exposing both systems to the environment. Sanitary Notice issued 16 November 2012 to Field # S1083.
74. CONTRIBUTES POLLUTION – Location: Lot 271, 3-5 Dove Shell Court, Horntown. No contact. Dwelling – “Pathfinder” RV on the waterfront. Flexible sewage hose is dry-rotted and coming apart, exposing system to the environment. Sanitary Notice issued 10 November 2012 to Field # S1084.
75. CONTRIBUTES POLLUTION – Location: Lot 273, 3-5 Dove Shell Court, Horntown. No contact. Dwelling – white RV. Sewage pipe’s cap is missing, with pipe end covered with dry-rotted duct tape. RV is occupied. No alternate sewage connection located. Sanitary Notice issued 16 November 2012 to Field # S1086. *Corrected prior to survey completion/publication.*
77. CONTRIBUTES POLLUTION – Location: Lot 312, 3-5 Neptune Court, Horntown. No contact. Dwelling – RV with unpainted T1-11 addition. Sewage pipe is uncapped and open to the environment. Sanitary Notice issued 30 November 2012 to Field # S1122. *Corrected prior to survey completion/publication.*

78. CONTRIBUTES POLLUTION – Location: Lot 326, 3-5 Nautilus Drive, Horntown. No contact. Dwelling – “Jayco” RV. Sewage pipe is uncapped and open to the environment. Sanitary Notice issued 30 November 2012 to Field # S1136. *Corrected prior to survey completion/publication.*
79. CONTRIBUTES POLLUTION – Location: Lot 327, 3-5 Nautilus Drive, Horntown. No contact. Dwelling – “Citation” RV. Sewage pipe is uncapped and open to the environment. Sanitary Notice issued 11 January 2013 to Field # S1137. *Corrected prior to survey completion/publication.*
80. CONTRIBUTES POLLUTION – Location: Lot 127, 3-3 Bay Breeze Drive, Horntown. No contact. Dwelling – “Prowler” RV. Sewage cap on RV is ported and attached to a garden hose, allowing any liquid waste to discharge to ground surface. Sanitary Notice issued 11 January 2013 to Field # S1153.
81. CONTRIBUTES POLLUTION – Location: Lot 146, 3-3 Limpet Drive, Horntown. No contact. Dwelling – “Holiday Rambler” RV with green frame addition. RV is set up to discharge raw sewage to the ground surface. Evidence of recent discharge with soil erosion. Ornamental grass planting screens view of discharge. Portable sewage tank is present but not in use. Sanitary Notice issued 11 January 2013 to Field # S1170.
82. CONTRIBUTES POLLUTION – Location: Lot 148, 3-3 Sea Mist Court, Horntown. No contact. Dwelling – “Quest” RV. Sewage pipe is uncapped, with open slide locks, leaving system open to the environment. Sanitary Notice issued 11 January 2013 to Field # S1173. *Corrected prior to survey completion/publication.*
83. CONTRIBUTES POLLUTION – Location: Lots 182 and 183, 3-3 Limpet Drive, Horntown. No contact. Dwelling – “Midas” RV. Flexible sewage hose is dry-rotted and starting to crack. Sanitary Notice issued 1 February 2013 to Field # S1211.
84. CONTRIBUTES POLLUTION – Location: Lot 184, 3-3 Limpet Drive, Horntown. No contact. Dwelling – RV. Flexible sewage hose is dry-rotted with holes that expose system to the environment. Sanitary Notice issued 1 February 2013 to Field # S1212.
85. CONTRIBUTES POLLUTION – Location: Lots 192, 3-3 Sun Ray Court, Horntown. No contact. Dwelling – “Wilderness” RV. Sewage hose is open to the environment, with open end on the ground surface. Sanitary Notice issued 15 February 2013 to Field # S1222.
86. CONTRIBUTES POLLUTION – Location: Lot 194, 3-3 Sun Ray Court, Horntown. No contact. Dwelling – “Sierra” RV. RV’s sewage hose is open with end lying on the ground. Sanitary Notice issued 15 February 2013 to Field # S1225.
87. CONTRIBUTES POLLUTION – Location: Lot 197, 3-3 Limpet Drive, Horntown. No contact. Dwelling – “Layton” RV. RV’s sewage hose is open to the environment. Sanitary Notice issued 15 February 2013 to Field # S1228.
88. CONTRIBUTES POLLUTION – Location: Lot 201, 3-3 Limpet Drive, Horntown. No contact. Dwelling – “Cyclone” RV. RV’s sewage hose is open to the environment. Sanitary Notice issued 15 February 2013 to Field # S1232.
89. CONTRIBUTES POLLUTION – Location: Lot 205, 3-3 Clam Court, Horntown. No contact. Dwelling – “Dreams” RV. Sewage hose is open to the environment. Sanitary Notice issued 15 February 2013 to Field # S1236.

90. CONTRIBUTES POLLUTION – Location: Lot 212, 3-3 Clam Court, Horntown. No contact. Dwelling – “Terry” RV. Sewage pipe is uncapped, and while slide-locks are closed, sewage is actively dripping from the pipe, with accumulated effluent in foamy puddle on the ground. Sanitary Notice issued 15 February 2013 to Field # S1241.
91. CONTRIBUTES POLLUTION – Location: Lot 230, 3-3 Bay Breeze Drive, Horntown. No contact. Dwelling – RV with roll-out awning. RV’s sewage pipe is uncapped and open to the environment. Sanitary Notice issued 15 February 2013 to Field # S1257. *Corrected prior to survey completion/publication.*
92. CONTRIBUTES POLLUTION – Location: Lot 7, 3-3 Bay Breeze Drive, Horntown. No contact. Dwelling – “Wilderness” RV. Sewage hose is open and on the ground, and portable sewage tank is uncapped, exposing sewage system to the environment. Sanitary Notice issued 22 February 2013 to Field # S1269.
94. CONTRIBUTES POLLUTION – Location: Lot 17, 3-3 Slipper Shell Drive, Horntown. No contact. Dwelling – “Trophy” RV. Sewage pipe to RV is uncapped and open to the environment. Sanitary Notice issued 22 February 2013 to Field # S1279. *Corrected prior to survey completion/publication.*
95. CONTRIBUTES POLLUTION – Location: Lot 20, 3-3 Slipper Shell Drive, Horntown. No contact. Dwelling – “Luxury Liner” RV. Flexible sewage hose is dry-rotted, with cracks and holes that expose system to the environment. Sanitary Notice issued 22 February 2013 to Field # S1284.
96. CONTRIBUTES POLLUTION – Location: Lot 21, 3-3 Slipper Shell Drive, Horntown. No contact. Dwelling – Covered RV with carport and 1-story vinyl shed with plumbing. Sewage pipes under shed are leaking, with icicles formed from pipes to ground surface. Sanitary Notice issued 22 February 2013 to Field # S1285.
97. CONTRIBUTES POLLUTION – Location: Lot 22, 3-3 Slipper Shell Drive, Horntown. No contact. Dwelling – “AlumaLite” RV. Sewage connection is uncapped, and open to the environment. Sanitary Notice issued 22 February 2013 to Field # S1286.
98. CONTRIBUTES POLLUTION – Location: Lot 26, 3-3 Slipper Shell Drive, Horntown. No contact. Dwelling – “Wilderness” RV. Flexible sewage hose has disintegrated and has come apart, exposing sewage system to the environment. Sanitary Notice issued 22 February 2013 to Field # S1291.
99. CONTRIBUTES POLLUTION – Location: Lot 31, 3-3 Slipper Shell Drive, Horntown. No contact. Dwelling – “Salem” RV. Septic tank lid has recently been lifted and is no properly seated, leaving a 5” gap open to the environment. Sanitary Notice issued 22 February 2013 to Field # S1296.
100. CONTRIBUTES POLLUTION – Location: Lot 43, 3-3 Slipper Shell Drive, Horntown. No contact. Dwelling – “Wilderness” RV. Flexible sewage hose has separated, exposing system to the environment. Sanitary Notice issued 8 March 2013 to Field # S1308.

101. CONTRIBUTES POLLUTION – Location: Lot 47, 3-3 Slipper Shell Drive, Horntown. No contact. Dwelling – green and white RV with 1-story tan vinyl addition. RV’s sewage pipe is disconnected from flexible sewage hose. Both pipe and hose are uncapped, exposing sewage system to the environment. Dried raw sewage with tissue on the ground. Sanitary Notice issued 8 March 2013 to Field # S1314 and...
- CONTRIBUTES POLLUTION (kitchen or laundry waste) – Washing machine is set up to discharge to ground surface, but is currently capped. Sanitary Notice issued 8 March 2013 to Field # S1314.
102. CONTRIBUTES POLLUTION – Location: Lot 58, 3-3 Slipper Shell Drive, Horntown. No contact. Dwelling – 1-story green T1-11 with RV. RV’s sewage pipe is uncapped and open to the environment. Sanitary Notice issued 8 March 2013 to Field # S1324.
Corrected prior to survey completion/publication.
103. CONTRIBUTES POLLUTION (kitchen or laundry waste) – Location: Lot 64, 3-3 Slipper Shell Drive, Horntown. No contact. Dwelling – 1-story red T1-11 with matching outbuildings. Set up to do laundry outdoors. Pipes and water connections present. Washing machine waste is set up to drain via an unsealed 2” PVC pipe that has unknown outfall under junk pile in yard. Sanitary Notice issued 8 March 2013 to Field # S1331.
104. CONTRIBUTES POLLUTION – Location: Lot 68, 3-3 Slipper Shell Drive, Horntown. No contact. Dwelling – “Breckenridge” park home. Flexible sewage hose is dry-rotted, with small holes and cracks that expose system to the environment. Sanitary Notice issued 8 March 2013 to Field # S1334 and...
- CONTRIBUTES POLLUTION (kitchen or laundry waste) – Washing machine set up in plastic shed, with drain pipe to ground surface. Sanitary Notice used 08 March 2013 to Field # S1334.
105. CONTRIBUTES POLLUTION – Location: Lot 76, 3-3 Bay Breeze Drive, Horntown. No contact. Dwelling – “Jayco” RV. Sewage pipe is open to the environment. Sanitary Notice issued 8 March 2013 to Field # S1343. *Corrected prior to survey completion/publication.*
106. CONTRIBUTES POLLUTION – Location: Lot 77, 3-3 Bay Breeze Drive, Horntown. No contact. Dwelling – “Sierra” RV. Flexible sewage hose and portable sewage tank are open to the environment. Sanitary Notice issued 8 March 2013 to Field # S1344.
107. CONTRIBUTES POLLUTION – Location: Lot 90, 3-3 Limpet Drive, Horntown. No contact. Dwelling – 1-story brown T1-11. Pipe to septic tank is open to the environment. Sanitary Notice issued 12 April 2013 to Field # S1358.
108. CONTRIBUTES POLLUTION – Location: Lots 10 & 11, 3-4 Bay Breeze Drive, Horntown. No contact. Dwelling – “Sunline” RV. Flexible sewage hose, connected to septic system, is disconnected from RV and is open to the environment. Sanitary Notice issued 12 April 2013 to Field # S1384.
109. CONTRIBUTES POLLUTION – Location: Lot 38, 3-4 Bay Breeze Drive, Horntown. No contact. Dwelling – “Coronado” RV. Flexible sewage hose has disintegrated and has completely separated, exposing sewage system to the environment. Sanitary Notice issued 19 April 2013 to Field # S1413.

110. CONTRIBUTES POLLUTION – Location: Lot 44, 3-3 Bay Breeze Drive, Horntown. No contact. Vacant lot with septic system to septic tank is open to the environment. Sanitary Notice issued 19 April 2013 to Field # S1419.
112. CONTRIBUTES POLLUTION – Location: Lot 56, 3-4 Oak Court, Horntown. No contact. Dwelling – “Terry” RV. Sewage pipe on RV is uncapped, with slides open. Sanitary Notice issued 19 April 2013 to Field # S1445. *Corrected prior to survey completion/publication.*
114. CONTRIBUTES POLLUTION – Location: Lot 114, 2-2 Bay Breeze Drive, Horntown. No contact. Dwelling – “Cimarron” RV. Flexible sewage hose has disintegrated, exposing sewage system to the environment. Sanitary Notice issued 19 April 2013 to Field # S1460.
115. CONTRIBUTES POLLUTION – Location: Lot 115, 2-2 Bay Breeze Drive, Horntown. No contact. Dwelling – “Sunline” RV. Septic tank pipe is open to the environment. Sanitary Notice issued 19 April 2013 to Field # S1461.
116. CONTRIBUTES POLLUTION – Location: Lot 121, 2-2 Blue Point Drive, Horntown. No contact. Dwelling – “Flair” RV. RV’s sewage pipe is uncapped and open to the environment. Sanitary Notice issued 26 April 2013 to Field # S1467. *Corrected prior to survey completion/publication.*
117. CONTRIBUTES POLLUTION – Location: Lot 149, 2-2 Sailfin Drive, Horntown. No contact. Dwelling – “Wilderness” RV. A short length of garden hose is fitted to a port on the lid for the RV’s sewage pipe, allowing liquid waste to discharge to the ground surface. Sanitary Notice issued 26 April 2013 to Field # S1500.
118. CONTRIBUTES POLLUTION – Location: Lot 154, 2-2 Sailfin Drive, Horntown. No contact. Dwelling – “Sunline” RV. RV’s sewage pipe has been damaged, leaving a large hole that exposes sewage system to the environment. Sanitary Notice issued 26 April 2013 to Field # S1505.
119. CONTRIBUTES POLLUTION – Location: Lot 165, 2-2 Sailfin Drive, Horntown. No contact. Dwelling – “Chateau” RV. Flexible sewage hose is dry-rotted, with holes that expose system to the environment. Sanitary Notice issued 10 May 2013 to Field # S1519.
120. CONTRIBUTES POLLUTION – Location: Lot 166, 2-2 Sailfin Drive, Horntown. No contact. Dwelling – “Taurus” RV. Sewage pipe is broken with a large hole that exposes system to the environment. Sanitary Notice issued 10 May 2013 to Field # S1520.
121. CONTRIBUTES POLLUTION – Location: Lot 171, 2-2 Sailfin Drive, Horntown. No contact. Dwelling – “Mallard” RV. Portable sewage tank’s flexible sewage hose is uncapped. Sanitary Notice issued 10 May 2013 to Field # S1526.
122. CONTRIBUTES POLLUTION – Location: Lot 447, 2-2 Bay Breeze Drive, Horntown. No contact. Dwelling – “Jayflight” RV. Portable sewage tank is open to the environment. Sanitary Notice issued 10 May 2013 to Field # S1538.

124. CONTRIBUTES POLLUTION – Location: Lot 193, 2-2 Sailfin Drive, Horntown. No contact. Dwelling – “Chateau” RV. Flexible sewage hose is dry-rotted and has disintegrated. Sanitary Notice issued 13 May 2013 to Field # S1573 and...

CONTRIBUTES POLLUTION (kitchen or laundry waste) – Laundry set up in shed with water supply line and waste pipe to discharge to ground surface. Sanitary Notice issued 13 May 2013 to Field # S1573.
125. CONTRIBUTES POLLUTION – Location: Lot 199, 2-2 Sailfin Drive, Horntown. No contact. Dwelling – 1 story beige vinyl. PVC pipe to septic tank is open to the environment. Sanitary Notice issued 13 May 2013 to Field # S1578.
126. CONTRIBUTES POLLUTION – Location: Lot 201, 2-2 Sailfin Drive, Horntown. No contact. Dwelling – “Palm Aire” RV. RV’s sewage pipe is uncapped and open to the environment. Sanitary Notice issued 13 May 2013 to Field # S1580. *Corrected prior to survey completion/publication.*
127. CONTRIBUTES POLLUTION – Location: Lot 203, 2-2 Sailfin Drive, Horntown. No contact. Dwelling – “Foxfire” RV. Flexible sewage hose is dry-rotted and coming apart. Sanitary Notice issued 13 May 2013 to Field # S1582.
129. CONTRIBUTES POLLUTION – Location: Lot 209A, 2-2 Sailfin Drive, Horntown. No contact. Dwelling – 1 story tan vinyl. Flexible sewage hose is cracked. Sanitary Notice issued 13 May 2013 to Field # S1589.
130. CONTRIBUTES POLLUTION – Location: Lot 435, 2-2 Bay Breeze Drive, Horntown. No contact. Dwelling – “Coachmen” RV. Pipe to septic tank is open to the environment. Sanitary Notice issued 13 May 2013 to Field # S1604.
131. CONTRIBUTES POLLUTION (kitchen or laundry waste) – Location: 1385 Ellis Street, Greenbackville. Dwelling – 1 Story Grey and White Home. Septic tank full and failing. Owner has left messages with Bundick Well and Pump Co. Grey water being pumped to cistern in back yard. Sanitary Notice issued 21 October 2011 to Field # D3.
132. CONTRIBUTES POLLUTION – Location: 1421 Franklin City Road, Greenbackville. Dwelling – white camper. Septic tank lid is cracked and made of an unapproved brick material. Contents in tank exposed. Sanitary Notice issued 21 October 2011 to Field # D25.
133. CONTRIBUTES POLLUTION – Location: 1531 Stockton Ave, Greenbackville. 2 Story white building behind the Post Office. Septic tank has cracks on two sides, leaking effluent. Piranha system. Sanitary Notice issued 2 December 2011 to Field # D79.
134. CONTRIBUTES POLLUTION – Location: 1520 Stockton Ave, Greenbackville. Dwelling – 1 Story grey with brick sides and white trim. Unapproved septic tank lid. Tank contents exposed to environment as lid is not seated properly. Sanitary Notice issued 2 December 2011 to Field # D81.
136. CONTRIBUTES POLLUTION – Location: 1424 Stockton Ave, Greenbackville. Dwelling – 2 Story light blue with white trim. Unapproved septic tank lid, a rotten piece of plywood serving as a lid. Effluent odor evident. Sanitary Notice issued 2 December 2011 to Field # D91.

137. CONTRIBUTES POLLUTION – Location: 39006 Church Street, Greenbackville. Dwelling – Beige trailer with grey shutters. Septic tank is cracked in several places, exposing contents to the environment. Sanitary Notice issued 16 December 2011 to Field # D105.
140. CONTRIBUTES POLLUTION – Location: 1502 Bayfront Street, Greenbackville. Dwelling – 2 story white with black shutters. No contact. Septic tank lid is not sealed. Odor evident when standing in close proximity. Air gap observed. Sanitary Notice issued 16 December 2011 to Field # D124.
142. CONTRIBUTES POLLUTION (**DIRECT**) – Location: 1535 Bayfront Street, Greenbackville. Dwelling – 1.5 story yellow with blue trim. Area in front of septic tank is clogged and organic liquid is present on the ground surface. Sanitary Notice issued 6 January 2012 to Field # D136.
143. CONTRIBUTES POLLUTION (kitchen or laundry waste) – Location: 2118 Harbor Drive, Greenbackville. Restaurant “The Crusty Crab”. Grease trap in poor repair. Unapproved lid (rotten plywood and shingles) covering pump housing. Kitchen waste on ground surface. Sanitary Notice issued 6 January 2012 to Field # D142.
145. CONTRIBUTES POLLUTION – Location: 38491 State Line Road, Greenbackville. Dwelling – 2 story white with grey shingles. Septic tank in poor repair. Effluent on ground surface, odor present. Effluent is concentrated in the area where the distribution box is located. Sanitary Notice issued on 20 January 2012 to Field # D160.
147. CONTRIBUTES POLLUTION – Location: 2230 Jolly Rodger Drive, Greenbackville. Dwelling – 2 story white with trim and grey shingles. Effluent on the ground surface at the terminal end of the drainfield. Odor evident. Sanitary Notice issued 1 February 2012 to Field # D198.
151. CONTRIBUTES POLLUTION – Location: 37473 Castaway Drive, Greenbackville. No contact. Recreational Vehicle. RV next to dwelling has grey water on ground surface under the rear wheels. No odor evident. Sanitary Notice issued 6 April 2012 to Field # D406.
154. CONTRIBUTES POLLUTION – Location: 4069 Captain’s Corridor, Greenbackville. Dwelling – 2 story brick with black shutters. No Contact. Septic tank lid (green plastic) has been damaged, exposing potential contents to the environment. No odor evident. Sanitary Notice issued 13 July 2012 to Field # D699.
155. CONTRIBUTES POLLUTION – Location: 2231 Buccaneer Boulevard, Greenbackville. Dwelling – 1.5 story tan with burgundy shutters. No contact. Clean out pipe on septic tank does not have a cap. No odor evident. Sanitary Notice issued 20 July 2012 to Field # D722.
156. CONTRIBUTES POLLUTION – Location: 2179 Spinnaker Street, Greenbackville. Dwelling – 2 story grey with white trim. No contact. Septic tank clean out pipe does not have a cap. Pipe is clogged with environmental debris. No odor evident. Sanitary Notice issued 20 July 2012 to Field # D726.
157. CONTRIBUTES POLLUTION – Location: 3775 Captain’s Corridor, Greenbackville. Dwelling – 1 story tan with green shutters. No contact. Septic tank clean out lid has been damaged, exposing contents to environment. No odor evident. Sanitary Notice issued 27 July 2012 to Field # D767.

158. CONTRIBUTES POLLUTION – Location: 36469 Yeoman Court, Greenbackville. Dwelling – 1.5 story white with black shutters. Septic tank lids improperly sealed, exposing content in the tank. Organic matter surrounding the edges of the lids. Septic effluent pooling in the drainfield area. Sanitary Notice issued 3 August 2012 to Field # D774.
164. CONTRIBUTES POLLUTION (kitchen or laundry waste) – Location: 35426 Justice Road, Horntown. Dwelling – 2 story tan with white trim. Laundry waste discharging to back of property on the ground surface via 2” pipe. Sanitary Notice issued 7 September 2012 to Field # D851.
165. CONTRIBUTES POLLUTION – Location: 5041 Pintail Drive, Lot 224, Horntown. Dwelling – “Spinnaker by Cobra” RV. Septic line terminates to flex-hose that has holes and is not sealed to septic connection. Effluent present on the ground surface. Sanitary Notice issued 7 September 2012 to Field # D865.
166. CONTRIBUTES POLLUTION – Location: Pintail Lane, Lot 246, Horntown. Dwelling – 38’ “Cove by Jayco” RV, white. No contact. Sewage connection and septic pipe are not connected properly. An air gap exists between the two. No effluent or odor evident. Sanitary Notice issued 14 September 2012 to Field # D882.
167. CONTRIBUTES POLLUTION – Location: 5028 Pintail Lane, Lot 643, Horntown. Dwelling – “Prowler” RV white and brown. No contact. Septic connection severed. No effluent or odor evident. Sanitary Notice issued 21 September 2012 to Field # D903.
168. CONTRIBUTES POLLUTION – Location: 5137 Pintail Drive, Lot 617, Horntown. Dwelling – “Bonanza” RV white with burgundy canopy. No contact. Septic hose from RV not airtight, with sewage pipe in ground. No effluent or odor present. Sanitary Notice issued 21 September 2012 to Field # D924.
169. CONTRIBUTES POLLUTION – Location: 5045 Blue Heron Drive, Lot 541 Horntown. Dwelling – “Wildwood” RV white with green trim. No contact. RV septic connection not capped, exposing system to the environment. Sanitary Notice issued 12 October 2012 to Field # D936. *Corrected prior to survey completion/publication.*
170. NO FACILITIES – Location: Pintail Drive, Lot 612, Horntown. Dwelling – “Argosy” RV white, 28’. No contact. No facilities found at the time of survey. Sanitary Notice issued 12 October 2012 to Field # D941.
171. CONTRIBUTES POLLUTION – Location: 5121 Blue Heron Drive, Lot 560, Horntown. Dwelling – “Wildwood” RV white with green shutters. No contact. Septic pipe from RV not connected to sewer line that goes to septic tank. No effluent or odor evident. Sanitary Notice issued 12 October 2012 to Field # D979.
172. CONTRIBUTES POLLUTION – Location: 5024 Blue Heron Drive, Lot 536 Horntown. Dwelling – “Cougar” RV white and blue, detached building. No contact. Septic line from RV not connected to sewer line. Sewer line to ground is not capped and is open to the environment. No effluent or odor evident. Sanitary Notice issued 19 October 2012 to Field # D987. *Corrected prior to survey completion/publication.*
173. NO FACILITIES – Location: Blue Heron Drive, Lot 530, Horntown. Dwelling – “Airstream” RV. No contact. No facilities found at the time of survey. Sanitary Notice issued 19 October 2012 to Field # D992.

174. NO FACILITIES – Location: Blue Heron Drive, Lot 529, Horntown. Dwelling – “Brandywine” RV beige with yellow vinyl addition. No contact. No facilities found at the time of survey. Sanitary Notice issued 19 October 2012 to Field # D993.
175. CONTRIBUTES POLLUTION – Location: Blue Heron Drive, Lot 523 Horntown. Dwelling – “Holiday Rambler” RV beige with red, white, and blue stripes. No contact. Septic connection from RV not capped. No effluent or odor evident. Sanitary Notice issued 19 October 2012 to Field # D999. *Corrected prior to survey completion / publication.*
176. CONTRIBUTES POLLUTION – Location: Blue Heron Drive, Lot 489 Horntown. Dwelling – “Gi-Gi” camper with Tan back addition. No contact. Septic line from RV not capped and not connected to holding tank. No effluent or odor evident. Sanitary Notice issued 26 October 2012 to Field # D1026. *Corrected prior to survey completion / publication.*
177. CONTRIBUTES POLLUTION – Location: Swan Drive, Lot 443 Horntown. Dwelling – “Chateau” camper with brown stripe. No contact. Septic line from RV not capped or connected to an approved septic system/holding tank. No effluent or odor evident. Sanitary Notice issued 26 October 2012 to Field # D1065. *Corrected prior to survey completion/publication.*
178. CONTRIBUTES POLLUTION – Location: Swan Drive, Lot 426, Horntown. Dwelling – “Eagle by Jayco” RV beige with brown stripes. No contact. Septic line from RV not connected to holding tank. No effluent on ground surface. Sanitary Notice issued 9 November 2012 to Field # D1077.
179. CONTRIBUTES POLLUTION – Location: 5023 Swan Drive, Lot 424, Horntown. Dwelling – “Wilderness by Fleetwood” RV, white. No contact. Severed sewage connection from the RV to the septic system. No effluent or odor evident. Sanitary Notice issued 9 November 2012 to Field # D1079.
180. CONTRIBUTES POLLUTION – Location: Crane Court, Lot 652, Horntown. Dwelling – “Bonanza” RV, off-white. No contact. Septic line from RV not connected to holding tank, which is present on-site. No effluent or odor evident. Sanitary Notice issued 9 November 2012 to Field # D1086.
181. CONTRIBUTES POLLUTION – Location: 5138 Swan Drive, Lot 389, Horntown. Dwelling – off-white camper covered with a green tarp. No contact. Severed sewage connection, airtight connection not established. Sanitary Notice issued 16 November 2012 to Field # D1114.
182. CONTRIBUTES POLLUTION – Location: 5174 Swan Drive, Lot 380 Horntown. Dwelling – “Bonanza” RV off white with a brown stripe. No contact. Septic pipe connection not capped or connected to an approved septic system. Sanitary Notice issued 16 November 2012 to Field # D1118. *Corrected prior to survey completion / publication.*
183. CONTRIBUTES POLLUTION – Location: Swan Drive, Lot 363 Horntown. Dwelling – “Prowler” off white with a blue stripe. No contact. Septic connection from camper not capped. Sanitary Notice issued 16 November 2012 to Field # D1128. *Corrected prior to survey completion/publication.*

184. CONTRIBUTES POLLUTION – Location: Lot 99 Trails End Drive, Horntown. Dwelling – “Sierra” camper, beige with brown stripe. No contact. Camper septic line is not capped. Holding tank is on-site. No effluent or odor evident. Sanitary Notice issued 30 November 2012 to Field # D1157. *Corrected prior to survey completion/publication.*
185. CONTRIBUTES POLLUTION – Location: 5070 Mallard Drive, Lot 53 Horntown. Dwelling – “Franklin” model camper beige, which is positioned behind the “Impala” camper on the same property. No contact. The “Franklin” camper does not have a cap on the septic line from the camper. Sanitary Notice issued 14 December 2012 to Field # D1204. *Corrected prior to survey completion/publication.*
186. CONTRIBUTES POLLUTION – Location: Mallard Drive, Lot 52 Horntown. Dwelling(s) – Front Camper “Chateau” beige. No contact. Camper has an uncapped septic line. Sanitary Notice issued 14 December 2012 to Field # D1205. *Corrected prior to survey completion/publication.*
187. CONTRIBUTES POLLUTION – Location: Mallard Drive, Lot 52, Horntown. Dwelling(s) – Rear Camper “Wilderness” white. No contact. Camper has a severed septic line. Sanitary Notice issued 14 December 2012 to Field # D1206.
188. CONTRIBUTES POLLUTION – Location: 5645 Trails End Drive, Lot 87, Horntown. Dwelling – “Terry” RV beige. No contact. 3” PVC sewage pipe runs from camper along the property boundary, with outfall at the road. Pipe is not connected to an n approved sewage system, nor is it capped. Sanitary Notice issued 4 January 2013 to Field # D1215.
189. CONTRIBUTES POLLUTION – Location: 5221 Pintail Drive, Lot 269 Horntown. Dwelling – 1 story tan building with T1-11 siding and a white building with green trim in the back. No contact. No cap present on septic line from camper. No effluent or odor evident. Sanitary Notice issued 4 January 2013 to Field # D1233. *Corrected prior to survey completion/publication.*
190. CONTRIBUTES POLLUTION – Location: Trails End Drive, Lot 113 Horntown. Dwelling – “Tag a Long” camper white and teal. No contact. Camper on-site does not have a cap on the septic line. Sanitary Notice issued 11 January 2013 to Field # D1263. *Corrected prior to survey completion/publication.*
191. CONTRIBUTES POLLUTION – Location: Bluebill Drive, Lot 155, Horntown. Vacant lot with sewage connection. No contact. Vacant lot has an unapproved lid (cinder block) covering the septic clean out pipe. Sanitary Notice issued 1 February 2013 to Field # D1297.
192. CONTRIBUTES POLLUTION – Location: Bluebill Drive, Lot 200, Horntown. Dwelling - “Sierra” camper, tan. No contact. Septic line from camper runs underneath camper and is not connected. Sanitary Notice issued 1 February 2013 to Field # D1318.
193. CONTRIBUTES POLLUTION – Location: Bluebill Drive, Lot 166, Horntown. Dwelling – “Sprinter” RV, white and teal. No contact. Septic line between RV and the holding tank is severed. Sanitary Notice issued 1 February 2013 to Field # D1343.
194. CONTRIBUTES POLLUTION – Location: Goldeneye Court, Lot 281 Horntown. Dwelling – “Prowler” camper white and teal. No contact. Camper does not have a cap on the septic outlet. Sanitary Notice issued 15 February 2013 to Field # D1348. *Corrected prior to survey completion/publication.*

195. CONTRIBUTES POLLUTION – Location: 35014 Goldeneye Court, Lot 286 Horntown. Dwelling – “Springdale” RV white. No contact. RV has two sewage outlet pipes and neither is properly capped. Sanitary Notice issued 15 February 2013 to Field # D1354. *Corrected prior to survey completion/publication.*
196. CONTRIBUTES POLLUTION – Location: Pintail Drive, Lot 287, Horntown. Dwelling – “Terry” camper, white with a blue stripe. Camper’s septic line not capped or connected to an approved holding tank. Waste evident on the ground surface, no odor. Sanitary Notice issued 15 February 2013 to Field # D1355.
197. CONTRIBUTES POLLUTION – Location: Mannoë Lane, Lot 55 Horntown. Dwelling – “Shasta” camper, off white. No contact. Camper does not have a cap on the septic outlet. No odor or effluent. Sanitary Notice issued 15 February 2013 to Field # D1379. *Corrected prior to survey completion/publication.*
198. CONTRIBUTES POLLUTION – Location: Mannoë Lane, Lot 41 Horntown. Dwelling – “Winnebago” tan with brown stripes. No contact. 33’ RV has no cap on the septic outlet. No effluent on ground surface. Sanitary Notice issued 19 February 2013 to Field # D1391. *Corrected prior to survey completion/publication.*
199. CONTRIBUTES POLLUTION – Location: Mannoë Court, Lot 37 Horntown. Dwelling – Unmarked camper, white with orange stripe. No contact. No cap on septic outlet. No odor or effluent. Sanitary Notice issued 19 February 2013 to Field # D1392. *Corrected prior to survey completion/publication.*
200. CONTRIBUTES POLLUTION – Location: Mannoë Court, Lot 34 Horntown. Dwelling – “Prowler”. No contact. RV has no cap on septic outlet. No odor or effluent. Sanitary Notice issued 19 February 2013 to Field # D1395. *Corrected prior to survey completion/publication.*
201. CONTRIBUTES POLLUTION – Location: 35016 Quahog Court, Lot 29 Horntown. Dwelling – “Nomad” RV off white with a teal stripe. No contact. No cap on sewage outlet. No odor or effluent. Sanitary Notice issued 22 February 2013 to Field # D1400. *Corrected prior to survey completion/publication.*
202. CONTRIBUTES POLLUTION – Location: 5042 Mannoë Court, Lot 24, Horntown. Dwelling – “Wilderness” RV white and green. No contact. Septic clean-out PVC pipe located in the back of the property is not capped properly, exposing the system to the environment. No odor or effluent. Sanitary Notice issued 22 February 2013 to Field # D1406.
203. CONTRIBUTES POLLUTION – Location: Mussell Court, Lot 18 Horntown. Dwelling – “Shasta” camper, off white with an orange stripe. No contact. Flexible sewage pipe not capped or connected. No odor or effluent noted. Sanitary Notice issued 22 February 2013 to Field # D1409. *Corrected prior to survey completion/publication.*
205. CONTRIBUTES POLLUTION – Location: Scallop Court, Lot 4, Horntown. Dwelling – “Prowler” camper with blue T-111 siding canopy. No contact. Flexible sewage pipe not connected or capped. Plywood covering septic clean out. No odor or effluent. Sanitary Notice issued 22 February 2013 to Field # D1421.

206. CONTRIBUTES POLLUTION – Location: Scallop Court, Lot 3 Horntown. Dwelling – “Jayco: RV, white with a teal stripe. No contact. No cap on septic outlet from RV. No odor or effluent. Sanitary Notice issued 22 February 2013 to Field # D1422. *Corrected prior to survey completion/publication.*
207. CONTRIBUTES POLLUTION – Location: 5099 Bluepoint Drive, Lot 26 Horntown. Dwelling – “Jayco” camper in the back of a 1 story yellow building. No contact. No cap on septic outlet. No odor or effluent. Sanitary Notice issued 22 February 2013 to Field # D1427. *Corrected prior to survey completion/publication.*
208. CONTRIBUTES POLLUTION – Location: Bluepoint Drive, Lot 27 Horntown. Dwelling - “Wilderness” RV, off-white. No contact. No cap on septic outlet. No odor or effluent. Sanitary Notice issued 22 February 2013 to Field # D1428. *Corrected prior to survey completion/publication.*
209. CONTRIBUTES POLLUTION – Location: Bluepoint Drive, Lot 52 Horntown. Dwelling – Unmarked camper behind a reddish screened porch. No contact. No cap on septic outlet. No odor or effluent. Sanitary Notice issued 1 March 2013 to Field # D1447. *Corrected prior to survey completion/publication.*
210. CONTRIBUTES POLLUTION – Location: Crabbing Pier Court, Lot 67, Horntown. Dwelling – “Wildwood” RV white with grey graphics. No contact. Flexible pipe not connected to holding tank. Pipe has outfall in ponding rain water. No odor or effluent. Sanitary Notice issued 1 March 2013 to Field # D1459.
211. CONTRIBUTES POLLUTION – Location: Crabbing Pier Court, Lot 68 Horntown. Dwelling – “Apeco” camper, white with orange and brown stripes. No contact. No cap on septic outlet. No odor or effluent. Sanitary Notice issued 1 March 2013 to Field # D1460. *Corrected prior to survey completion/publication.*
212. CONTRIBUTES POLLUTION – Location: Crabbing Pier Court, Lot 70, Horntown. Dwelling – “Wilderness” RV white and brown. No contact. Flexible sewage pipe not connected to the on-site holding tank. No odor or effluent. Sanitary Notice issued 1 March 2013 to Field # D1462.
213. CONTRIBUTES POLLUTION – Location: Bluepoint Drive, Lot 75, Horntown. Dwelling – White SW Trailer with Black Shutters. No contact. 4” PVC sewage pipe under home is not capped nor connected. No odor or effluent. Sanitary Notice issued 8 March 2013 to Field # D1465.
214. CONTRIBUTES POLLUTION – Location: East Wind Court, Lot 3, Horntown. Dwelling – “Aly” Camper by Skyline. Beige with orange stripes. No contact. No cap on camper’s septic outlet. Aged paper towel residue on ground surface. No odor. Sanitary Notice issued 8 March 2013 to Field # D1471.
215. CONTRIBUTES POLLUTION – Location: 5255 Bluepoint Drive, Lot 86 Horntown. Dwelling – “Skylark” camper with tiki bar on-site. No contact. No cap on camper’s septic outlet. No odor or effluent. Sanitary Notice issued 8 March 2013 to Field # D1479. *Corrected prior to survey completion/publication.*
216. CONTRIBUTES POLLUTION – Location: 5323 Bluepoint Drive, Lot 103, Horntown. Dwelling – “Coachmen” RV white with blue stripes. No contact. Flexible sewage pipe not connected to holding tank located on-site. No effluent or odor detected. Sanitary Notice issued 8 March 2013 to Field # D1493.

217. CONTRIBUTES POLLUTION – Location: Bay Breeze Drive, Lot 513, Horntown. Dwelling – “Franklin” RV white with yellow stripe. No contact. Septic outlet from RV not capped. Flexible sewage pipe on the ground. No effluent or odor. Sanitary Notice issued 15 March 2013 to Field # D1508.
218. CONTRIBUTES POLLUTION – Location: 6447 Bay Breeze Drive, Lot 507, Horntown. Dwelling – “Hornet” by Keystone RV, white. No contact. Flexible sewage pipe not connected to a septic system or holding tank. No effluent or odor. Sanitary Notice issued 15 March 2013 to Field # D1512.
219. CONTRIBUTES POLLUTION – Location: 35027 Starfish Court, Lot 484 Horntown. Dwelling – “Holiday” camper white with red, white, and blue stripes. No contact. Camper septic outlet not capped. No effluent or odor. Sanitary Notice issued 15 March 2013 to Field # D1528. *Corrected prior to survey completion/publication.*
220. CONTRIBUTES POLLUTION – Location: 35022 Starfish Court, Lot 483 Horntown. Dwelling – White and burgundy RV. No contact. RV’s septic outlet not capped. No effluent or odor. Sanitary Notice issued 15 March 2013 to Field # D1529. *Corrected prior to survey completion/publication.*
221. CONTRIBUTES POLLUTION – Location: 35018 Starfish Court, Lot 482 Horntown. Dwelling – “Prowler” RV white. No contact. RV’s septic outlet not capped. No odor or effluent. Sanitary Notice issued 15 March 2013 to Field # D1530. *Corrected prior to survey completion/publication.*
222. CONTRIBUTES POLLUTION – Location: Bay Breeze Drive, Lot 304, Horntown. Dwelling – “Mountaineer” RV white with graphics. No contact. Flexible sewage pipe not connected to septic PVC. No effluent or odor. Sanitary Notice issued 5 April 2013 to Field # D1544.
223. CONTRIBUTES POLLUTION – Location: 6586 Bay Breeze Drive, Lot 413 Horntown. Dwelling – “Prowler” camper white with teal graphics. Josephine Lincoln Lane, Owner. No contact. No cap on camper septic outlet. No effluent or odor. Sanitary Notice issued 19 April 2013 to Field # D1559. *Corrected prior to survey completion/publication.*
225. CONTRIBUTES POLLUTION – Location: 5031 Silverside Drive, Lot 314 Horntown. Dwelling – “Arabian” camper white with orange stripe. No contact. Front camper has no cap on septic outlet. Sanitary Notice issued 19 April 2013 to Field # D1575. *Corrected prior to survey completion/publication.*
226. CONTRIBUTES POLLUTION – Location: 5035 Silverside Drive, Lot 315 Horntown. Dwelling – “Shasta” RV white with teal and blue stripes. No contact. No cap on septic outlet. No effluent or odor. Sanitary Notice issued 19 April 2013 to Field # D1577. *Corrected prior to survey completion/publication.*
227. CONTRIBUTES POLLUTION - Location: Bluepoint Drive, Lot 344, Horntown. Dwelling – “Wilderness” Yukon camper. No contact. No cap present on septic outlet. Flexible sewage pipe and holding tank are not connected. No effluent or odor. Sanitary Notice issued 26 April 2013 to Field # D1599.

228. CONTRIBUTES POLLUTION – Location: Bluepoint Drive, Lot 348, Horntown. Dwelling – “Wilderness” camper with a white structure attached. No contact. No cap on septic outlet. No effluent or odor. Sanitary Notice issued 26 April 2013 to Field # D1603. *Corrected prior to survey completion/publication.*
231. CONTRIBUTES POLLUTION – Location: Silverside Drive, Lot 293, Horntown. Dwelling – “Taurus” camper white with brown stripe. No contact. Flexible sewage pipe not connected to the on-site holding tank. Sanitary Notice issued 10 May 2013 to Field # D1690.
232. CONTRIBUTES POLLUTION – Location: Silverside Drive, Lot 303, Horntown. Dwelling – “Salem” camper white with teal stripes. No contact. Septic pipe not connected. Raw sewage on ground surface and odor evident. Sanitary Noticed issued 10 May 2013 to Field # D1697.
233. CONTRIBUTES POLLUTION – Location: Silverside Drive, Lot 304 Horntown. Dwelling – “Terry” camper white. No contact. No cap on septic outlet, No effluent or odor. Sanitary Notice issued 10 May 2013 to Field # D1698. *Corrected prior to survey completion/publication.*
234. CONTRIBUTES POLLUTION – Location: Silverside Drive, Lot 305 Horntown. Dwelling – “Prowler” (camper on the left). No contact. No cap on septic outlet. No effluent or odor. Sanitary Notice issued 10 May 2013 to Field # D1699. *Corrected prior to survey completion/publication.*
235. CONTRIBUTES POLLUTION – Location: Silverside Drive, Lot 305 Horntown. Dwelling – “Salem” (camper on the right). No contact. No cap on septic outlet. No effluent or odor. Sanitary Notice issued 10 May 2013 to Field # D1700. *Corrected prior to survey completion/publication.*
237. CONTRIBUTES POLLUTION – Location: 5078 Bream Drive, Lot 238 Horntown. Dwelling – white camper. No contact. No cap on septic outlet. No effluent or odor. Sanitary Notice issued 10 May 2013 to Field # D1723. *Corrected prior to survey completion/publication.*
238. CONTRIBUTES POLLUTION – Location: 5118 Bream Drive, Lot 228, Horntown. Dwelling – “Terry” camper white with blue stripe. No contact. Flexible sewage pipe cracked and not securely attached. Sanitary Notice issued 10 May 2013 to Field # D1730.

POTENTIAL POLLUTION

2. Location: Mill Dam Road, Soil, stone, and demolition debris storage yard. No contact. Frequent heavy equipment usage and storage of materials prone to run-off. Field # S2.
55. Location: Lot 139, 3-6 Wallops Mill Drive, Horntown. Dwelling – “Wildwood” RV. No contact. A one inch hose exits underpinning, is clamped to the edge of the walk, with outfall on gravel. No source identified. No evidence of effluent discharge. Field # S671.
61. Location: Lot 237, 3-6 Bluebill Drive, Horntown. No contact. Dwelling – 1 story tan vinyl. A 2” PVC pipe exits underside of building and goes to the ground, ending in a blind cap. Possible capped line for grey-water discharge to ground surface during seasonal occupation. Field # S746.

93. Location: Lot 12, 3-3 Bay Breeze Drive, Horntown. No contact. Dwelling – “Town & Country” park home. Possible laundry pipe to ground. Dryer is in shed. Pipe with no apparent discharge exits ground near shed and runs along ground. Field # S1274.
123. Location: Lot 187, 2-2 Sailfin Drive, Horntown. No contact. Dwelling – “Hornet” RV. Pipe from shed has outfall to ground surface. No evidence of discharge. Field # S1567.
128. Location: Lot 208, 2-2 Sailfin Drive, Horntown. No contact. Dwelling – 1 story brown T1-11 with RV. Pipe of unknown origin with outfall to ground surface. No evidence of recent discharge. Grey water suspected. Field # S1587.
135. Location: 1448 Stockton Avenue Greenbackville. Dwelling – 2 story beige home with white trim. Questionable ditch that splits yard and the back yard. Owner states that ditch fills and septic is slow during heavy rainfalls. No obvious issues at survey. Field # D88.
138. Location: 1474 and 1480 Bayfront Road, Greenbackville. Dwelling – 1474, 1-story light grey with blue shutters; 1480, 2-story white siding. Owner states that the septic tank area has developed a depression. No evidence of effluent on ground surface. Field # D121.
141. Location: 1540 Bayfront Street, Greenbackville. Dwelling – 2 story vacation home, yellow with white trim. No contact. Septic tank is warped, depression in the middle of the concrete. No effluent or evidence of sewage exposure. Field # D130.
148. Location: 37303 Davey Jones Boulevard, Greenbackville. Dwelling – 2 story brick facade, beige siding. No contact. 1.5” PVC pipe coming out of the back of the house. Straight pipe of undetermined source. Field # D208.
149. Location: 38040 Davey Jones Boulevard, Greenbackville. Dwelling – 2 story tan with white trim. No contact. Clean out cap marginally damaged by lawn mower or other equipment. No evidence of exposure. Field # D246.
150. Location: 2310 Captain’s Corridor, Greenbackville. Dwelling – 2 Story White Victorian with Green Shutters. No contact. 1” PVC coming from house foundation on SW side, terminating into a small ditch in the front yard. No evidence of discharge at the time of survey. Field # D337.
159. Location: Pump station for Captains Cove Sewer. South end near Swan Gut Creek. Pump station tanks under construction. The tanks on-site are being replaced but not completed at inspection. Field # D797.
204. Location: Scallop Court Trails End Campground, Horntown. Dwelling – “Cavalier” RV white with blue trim. No contact. End cap on septic pipe not completely secure on the pipe. No evidence of recent use. Field # D1420.
224. Location: Silverside Road, Lot 313, Horntown. Dwelling – “Citation” camper. No contact. Duct tape used to secure septic pipe to system. No evidence of effluent or odor detected. Field # D1573.
229. Location: 5069 Bream Drive, Lot 280, Horntown. Dwelling – “Resort” camper behind a “Mallard” 1 sty home. No contact. Septic lid is attached to septic outlet with duct tape. The camper does not appear to be frequently used and no effluent was detected at survey. Field # D1663.

230. Location: Silverside Drive, Lot 292, Horntown. Dwelling – “Monitor America” camper, off white with brown stripe. Flexible sewage pipe not securely attached to holding tank. No evidence of problems as a result of the loose connection. Field # D1689.
236. Location: 36008 Bream Court, Lot 256, Horntown. Dwelling – “Sunnybrook” RV, white. No contact. Duct tape on septic pipe. No sign of leakage at survey. Field # D1705.

SECTION C: NONSEWAGE WASTE SITES

SOLID WASTE

111. Location: Trails End Campground Maintenance Shed, Bay Breeze Drive, Horntown. Waste motor oil tank has containment pit that has a layer of waste oil floating on rainwater, with the oil running out of the drain port on the side, spilling waste oil on the ground. Field # S1431.
113. Location: Trails End Restaurant, 1-story grey stucco. Waste cooking oil container in back of restaurant is improperly maintained, with oil spilled across the ground and streaked over the outer wall of walk-in cooler. Field # S1450.

SECTION D: BOATING ACTIVITY

MARINAS

76. Trails End Boat Ramp, Nautilus Drive, Horntown. No contact. Two boat ramps, fishing pier, 40 boat slips, fish cleaning station. Water, trash receptacles, and emergency phone service provided. At inspection, 1 paddle boat and 1 pleasure boat < 18 feet were present. A high percentage of park lots have boats present. Field # S1100.
144. Greenbackville Harbor, P.O. Box 74 Greenbackville. Jim Pruitt, Harbor Master. 78 slips. Present at the time of the survey were 21 pleasure boats under 26'. No boats over 26' and no work boats present. Boating services provided are water and a ramp. There is no longer a fuel service. Sanitary facilities provided are 1 vault privy for men and 1 vault privy for women. Boat holding pump out stations are provided at this location. The system was not exercised on 1-20-2012. Sewage is pumped and hauled by a private contractor. Field # D153.
160. Captain's Cove Golf and Yacht Club, 3323 Dock Court, Greenbackville. Rob Giard, Harbor Master. 48 seasonal slips, 6 transient slips, and 4 daily slips for club use with a 3 hour limit. Present at the time of survey were 14 recreational boats under 26' and 1 recreational boat over 26'. Boating services provided are water, electricity, and a ramp. Sanitary facilities provided are 2 commodes, 3 lavatories, 1 urinal for men and 2 commodes and 3 lavatories for women. Boat holding pump-out facilities are available upon request. Sewage is pumped to the community sewage treatment plant. Field # D812.

OTHER PLACES WHERE BOATS ARE MOORED

-None-

SECTION E: CONTRIBUTES ANIMAL POLLUTION

131. Location: 1385 Ellis Street, Greenbackville. Dwelling – 1 story grey home with white trim. Chris Hughes, Owner. Chicken coop in the back of the property housing 42 chickens, none of which are given free range. There is a drainage ditch located about 20 feet from the coop. Field # D3.
146. Location: 1495 Culver Lane, Greenbackville. Dwelling – 2 story white asbestos shingles with a grey metal roof. 1 bull, 3 cows, and 4 calves on site. The broiler houses on the back of the property are being demolished by controlled burning until they are gone. Powell Creek is in close proximity. Field # D171.
161. Location: 36365 Hall Road, Greenbackville. Dwelling – 1-1/2 story tan DW with blue shutters. No contact. 5 chickens in a coop in the back of property. The coop is ~600 feet from Swan's Gut Creek. Field # D821.
162. Location: 2276 Fleming Road, New Church. Dwelling – 1 story beige cedar shake. Two horses, 1 rooster, 1 turkey on site. Property has a horse barn and a pasture for the two horses. There is a roost near the back of the property within 600 feet of Swan's Gut Creek. Field # D827.
163. Location: 2170 Fleming Road, New Church. F.A. Holland, Owner. Two residences on the farm. Five horses in the barn at survey within 1000' of Swan's Gut Creek. The large farm outbuildings appear to be used for equipment storage. Field # D828.
164. Location: 35426 Justice Road, Horntown. Dwelling – 2 story tan and white house. 5 goats and 6 chickens in a fenced-in pasture in the back of the property which was sparsely wooded. Small houses were provided for the animals. Field # D851.

SUMMARY

Growing Area # 100
Chincoteague Bay
5 July 2013

SECTION B: SEWAGE POLLUTION SOURCES

1. SEWAGE TREATMENT FACILITIES

- 1 – DIRECT – # 1
- 2 – INDIRECT – # 152, 153
- 3 – B.1. TOTAL

2. ON-SITE SEWAGE DEFICIENCIES – Correction of the deficiencies in this section is the responsibility of the local health department.

- 1 – CONTRIBUTES POLLUTION, DIRECT – # 142
- 194 – CONTRIBUTES POLLUTION, INDIRECT – # 3, 4, 5, 6, 7, 8, 9, 10, 11, 12, 13, 14, 15, 16, 17, 18, 19, 20, 21, 22, 23, 24, 25, 26, 27, 28, 29, 30, 31, 32, 33, 34, 35, 36, 37, 38, 40, 41, 42, 43, 44, 45, 46, 47, 48, 50, 52, 53, 54, 56, 57, 58, 59, 60, 64, 65, 66, 67, 68, 69, 70, 71, 72, 73, 74, 75, 77, 78, 79, 80, 81, 82, 83, 84, 85, 86, 87, 88, 89, 90, 91, 92, 94, 95, 96, 97, 98, 99, 100, 101, 102, 104, 105, 106, 107, 108, 109, 110, 112, 114, 115, 116, 117, 118, 119, 120, 121, 122, 124, 125, 126, 127, 129, 130, 132, 133, 134, 136, 137, 140, 145, 147, 151, 154, 155, 156, 157, 158, 165, 166, 167, 168, 169, 171, 172, 175, 176, 177, 178, 179, 180, 181, 182, 183, 184, 185, 186, 187, 188, 189, 190, 191, 192, 193, 194, 195, 196, 197, 198, 199, 200, 201, 202, 203, 205, 206, 207, 208, 209, 210, 211, 212, 213, 214, 215, 216, 217, 218, 219, 220, 221, 222, 223, 225, 226, 227, 228, 231, 232, 233, 234, 235, 237, 238
- 0 – CP (Kitchen or Laundry Wastes), DIRECT – None
- 12 – CP (Kitchen or Laundry Wastes), INDIRECT – # 39, 49, 51, 62, 63, 101, 103, 104, 124, 131, 143, 164
- 0 – NO FACILITIES, DIRECT – None.
- 3 – NO FACILITIES, INDIRECT – # 170, 173, 174
- 210 – B.2. TOTAL

3. POTENTIAL POLLUTION

- 18 – POTENTIAL POLLUTION – # 2, 55, 61, 93, 123, 128, 135, 138, 141, 148, 149, 150, 159, 204, 224, 229, 230, 236

SECTION C: NON-SEWAGE WASTE SITES

1. INDUSTRIAL WASTE SITES

- 0 – DIRECT – None
- 0 – INDIRECT – None
- 0 – C.1. TOTAL

2. SOLID WASTE DUMPSITES

- 0 – DIRECT – None
- 2 – INDIRECT – # 111, 113
- 2 – C.2. TOTAL

SECTION D: BOATING ACTIVITY

- 3 – MARINAS – # 76, 144, 160
- 0 – OTHER PLACES WHERE BOATS ARE MOORED – None
- 0 – UNDER SURVEILLANCE – None
- 3 – D. TOTAL

SECTION E: CONTRIBUTES ANIMAL POLLUTION

0 – DIRECT – None.

6 – INDIRECT – # 131, 146, 161, 162, 163, 164


6 – E. TOTAL

Virginia Department of Health
Division of Shellfish Sanitation


Chincoteague Bay
100
Shoreline Sanitary Survey

Accomack County


Date: 5 July 2013
Survey By: S.E. Price and D.P. Miller
Number of Properties Surveyed: 3345

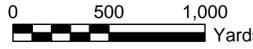

Insert 1

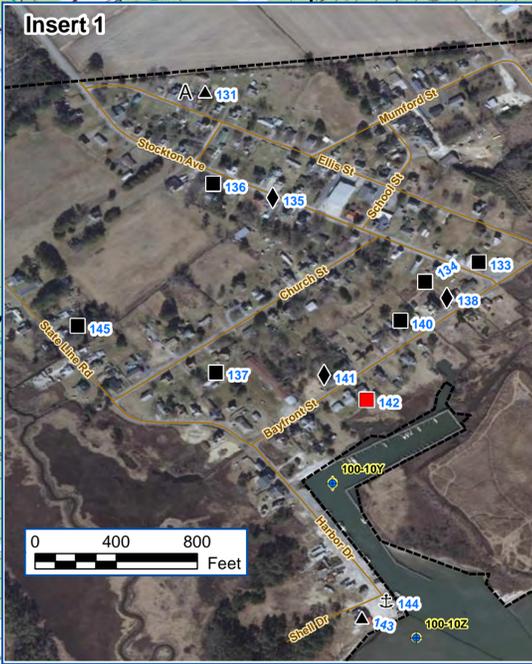

Insert 2

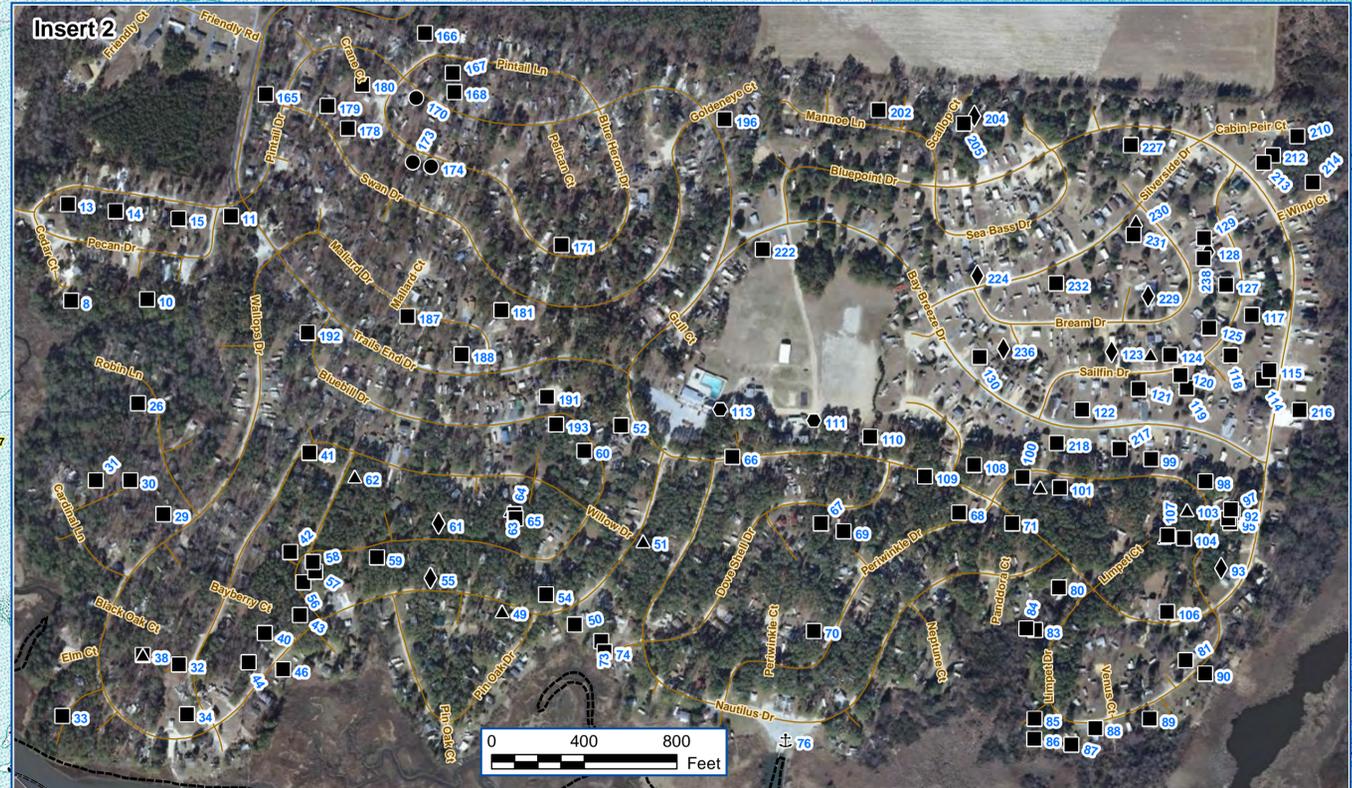

Geographic coordinates in NAD83 datum;
shown in degrees, minutes & seconds.

